

# INSPECTION REPORT

End of contract

## GENERAL INFO

File	310896
License plate	2BSA416
Vehicle identification number	VF3MCYHZUNS038167
Dossier	2021231072
Make	Peugeot 5008 1.5BHdi 96kW GT A
Mileage	122817
First registration	02/03/2022
client availability date	24/04/2026
inspectionDate	05/06/2026

## CHECK POINTS

Description	Number	Present	Remark
Original license plate		Y	
Registration Part 2		N	
Keys	2	Y	
Spare wheel		N	
Towbar (+keys)		Y	
Certificate of conformity		Y	
Registration certificate		Y	
Repair kit		Y	
RunOnFlat		N	
Charging cable		N	
Charge back wrong tyres		Y	






## DAMAGES

Damages	Type	Acceptable
134	Bumper Rear // Repair & Painting	N
138	Bumper Rear / Lower Cover Not Painted / Replace	N
183	Wing Rear Right // Painting	N
13	Bumper Front // Painting	N
64	Wing Front Left // Repair & Painting	N
67	Wing Front Left / Trim / Replace	N
87	Door Front Left / Trim / Replace	Y
107	Door Rear Left / Trim / Replace	Y
91	Rocker Panel Left // Smart Repair Medium	N
104	Door Rear Left // Repair & Painting	N
33	Front Bonnet // Repair & Painting	Y
38	Front Bonnet / Insulation / Replace	N
80	Door Front Left // Smart Repair Small	Y
114	Wing Rear Left // Repair & Painting	Y
124	Light / Rear left / Replace	Y
125	Light / Rear Left On Rear Bonnet / Replace	Y
165	Roof // Polish	Y
174	Light / Rear Right / Replace	Y
175	Light / Rear Right On Rear Bonnet / Replace	Y
193	Door Rear Right // Painting	N
213	Door Front Right // Painting	N
228	Side View Mirror Right / Direction Indicator / Replace	N
233	Wing Front right // Painting	N
237	Wing Front right / Trim / Replace	Y
310	Wheel Two Tone Front Left // Repair	N
330	Wheel Two Tone Rear Right // Repair	N
412	Seat Front Left / Bottom Coating / Replace	Y
421	Seat Front Right // Repair	N
594	Trunk Lid Interior Coating / Complete Panel / Replace	N
644	Rear Right Door Interior Coating // Replace Completely	Y

Damage Pictures



Wheel Two Tone Front Left // Repair-scratch

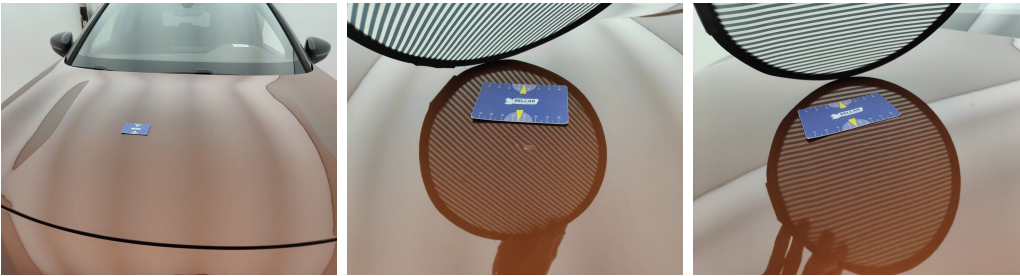

Front Bonnet // Repair & Painting-scratch + dent



Wheel Two Tone Rear Right // Repair-scratch



Light / Rear Left On Rear Bonnet / Replace-scratch



Light / Rear left / Replace-scratch



Light / Rear Right On Rear Bonnet / Replace-scratch




Light / Rear Right / Replace-scratch



Trunk Lid Interior Coating / Complete Panel / Replace-scratch



Seat Front Right // Repair-scratch

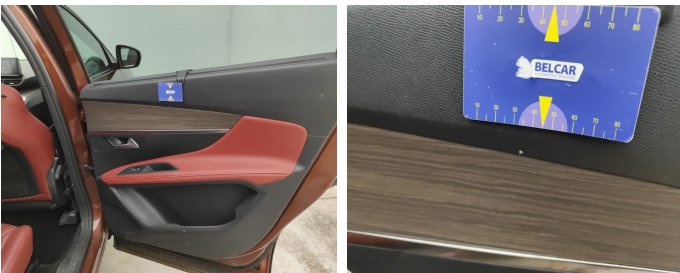


Rear Right Door Interior Coating // Replace Completely-scratch




Interior / Side Cover rear Seat / Replace-scratch



Side View Mirror Right / Direction Indicator / Replace-scratch

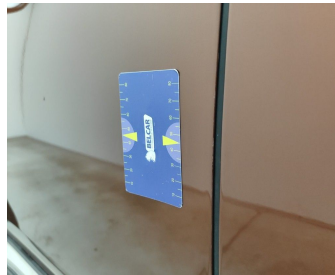

Door Front Left // Smart Repair Small-scratch + dent

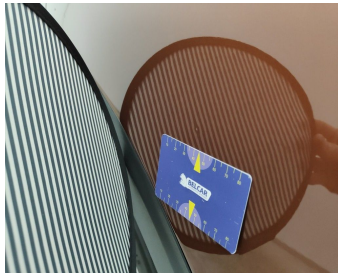


Wing Rear Left // Repair & Painting-scratch + dent



Door Front Right // Painting-bad repair




Wing Front right // Painting-bad repair

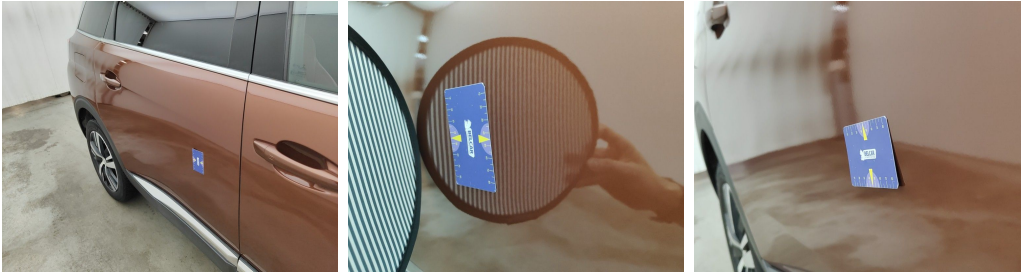

Door Rear Right // Painting-bad repair



Roof // Polish-Chemical reaction

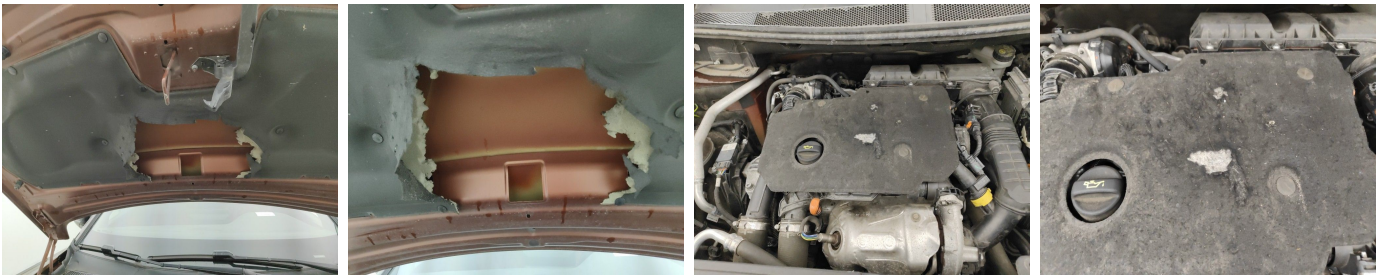

Front Bonnet / Insulation / Replace-tear



Seat Front Left / Bottom Coating / Replace-worn



Wing Front right / Trim / Replace-bad position



Wing Rear Right // Painting-scratch




Bumper Rear / Lower Cover Not Painted / Replace-scratch



Bumper Rear // Repair & Painting-scratch + dent



Rocker Panel Left // Smart Repair Medium-scratch

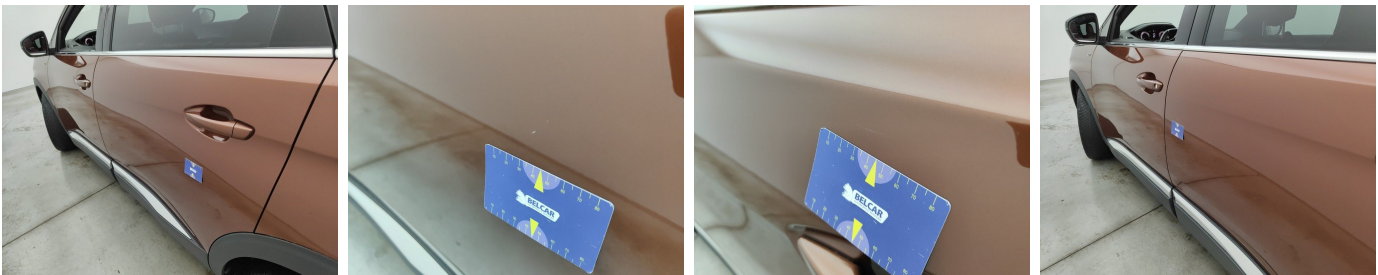

Door Rear Left // Repair & Painting-scratch



Wing Front Left // Repair & Painting-scratch + dent



Bumper Front // Painting-scratch



Wing Front Left / Trim / Replace-scratch



Door Rear Left / Trim / Replace-scratch



Door Front Left / Trim / Replace-scratch