

INSPECTION REPORT



End of contract


GENERAL INFO

File	321073
License plate	2DHT996
Vehicle identification number	VF3MCYHZUPS046010
Dossier	2022 341 011
Make	Peugeot 5008 1.5BHDi 96kW Allu
Mileage	194302
First registration	23/03/2023
client availability date	31/08/2026
inspectionDate	09/09/2026

CHECK POINTS

Description	Number	Present	Remark
Original license plate		Y	
Registration Part 2		N	
Keys	2	Y	
Spare wheel		N	
Towbar (+keys)		Y	
Certificate of conformity		Y	
Registration certificate		Y	
Repair kit		N	
RunOnFlat		N	
Charging cable		N	
Charge back wrong tyres		N	

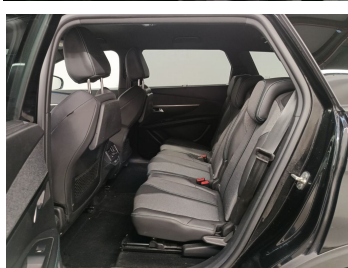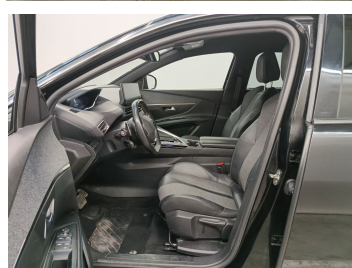

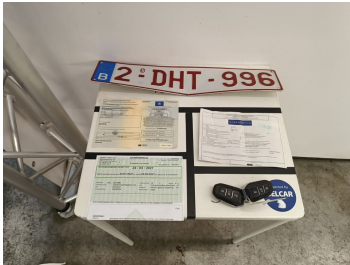


DAMAGES

Damages	Type	Acceptable
13	Bumper Front // Painting	N
237	Wing Front right / Trim / Replace	N
117	Wing Rear Left / Trim / Replace	N
131	Bumper Rear // Smart Repair Medium	N
187	Wing Rear Right / Trim / Replace	N
194	Door Rear Right // Repair & Painting	N
197	Door Rear Right / Trim / Replace	N
891	Lettering Removal 15min	N
32	Front Bonnet // Painting	Y
41	Windshield // Replace	Y
83	Door Front Left // Painting	Y
87	Door Front Left / Trim / Replace	N
91	Rocker Panel Left // Smart Repair Medium	Y
104	Door Rear Left // Repair & Painting	N
110	Wing Rear Left // Smart Repair Small	Y
154	Rear Bonnet // Repair & Painting	N
216	Door Front Right // Polish	Y
217	Door Front Right / Trim / Replace	Y
272	Bumper Front / Trim Right / Replace	Y
310	Wheel Two Tone Front Left // Repair	N
340	Wheel Two Tone Front Right // Repair	N
346	Tyre Front Right // Replace	N
412	Seat Front Left / Bottom Coating / Replace	Y
431	Seat Rear Left // Repair	Y
532	Trunk Compartment / Side Cover Left / Replace	Y
540	Interior // Repair 1	Y
569	Dashboard / Steering Wheel / Replace	Y
594	Trunk Lid Interior Coating / Complete Panel / Replace	Y
634	Rear Left Door Interior Coating // Replace Completely	Y
644	Rear Right Door Interior Coating // Replace Completely	Y

Damage Pictures



Door Front Right / Trim / Replace-scratch

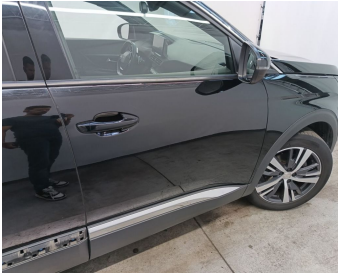

Door Front Right // Polish-scratch



Bumper Front / Trim Right / Replace-scratch



Wing Rear Left // Smart Repair Small-scratch



Door Front Left // Painting-scratch



Door Front Left / Trim / Replace-scratch




Wheel Two Tone Front Left // Repair-scratch




Wheel Two Tone Front Right // Repair-scratch



Windshield // Replace-scratch

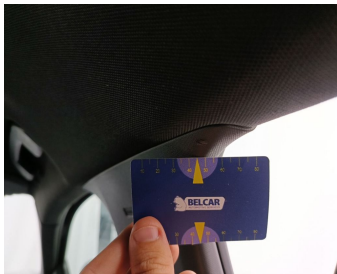

Interior // Repair 1-scratch

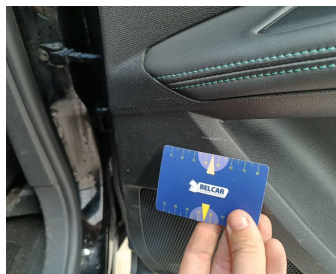


Rear Right Door Interior Coating // Replace Completely-scratch



Trunk Compartment / Side Cover Left / Replace-scratch




Trunk Lid Interior Coating / Complete Panel / Replace-scratch

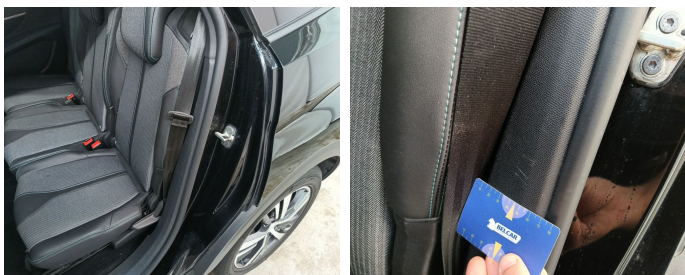

Seat Rear Left // Repair-scratch



Rear Left Door Interior Coating // Replace Completely-scratch

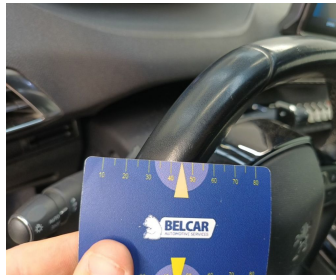

Dashboard / Steering Wheel / Replace-scratch







Rocker Panel Left // Smart Repair Medium-dent



Door Rear Left // Repair & Painting-scratch + dent



Rear Bonnet // Repair & Painting-scratch + dent

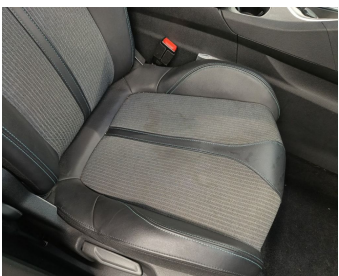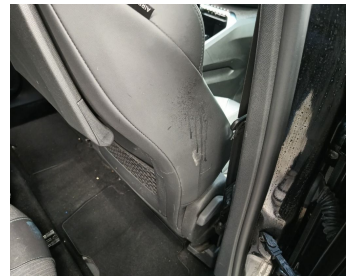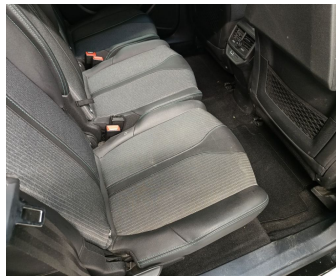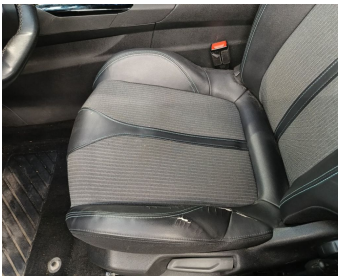

Interior Cleaning // Small-dirty



Tyre Front Right // Replace-tear



Seat Front Left / Bottom Coating / Replace-worn



Front Bonnet // Painting-stone chipping



Bumper Front // Painting-scratch




Wing Front right / Trim / Replace-scratch



Lettering Removal 15min-



Bumper Rear // Smart Repair Medium-scratch

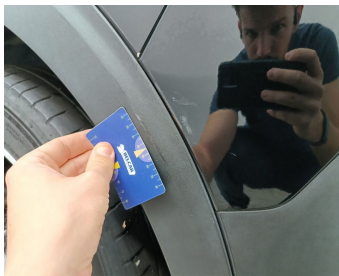

Wing Rear Left / Trim / Replace-scratch



Door Rear Right / Trim / Replace-missing



Wing Rear Right / Trim / Replace-scratch + dent



Door Rear Right // Repair & Painting-scratch + dent