

INSPECTION REPORT



End of contract

GENERAL INFO

File	309819
License plate	2BNR398
Vehicle identification number	YV1XZBWVFN2739622
Dossier	2021166046
Make	Volvo XC40 T4 PHEV R-Design.Gt
Mileage	113401
First registration	27/01/2022
client availability date	02/04/2026
inspectionDate	14/04/2026

CHECK POINTS

Description	Number	Present	Remark
Original license plate		Y	
Registration Part 2		N	
Keys	2	Y	
Spare wheel		N	
Towbar (+keys)		N	
Certificate of conformity		Y	
Registration certificate		Y	
Repair kit		Y	
RunOnFlat		N	
Charging cable		Y	
Charge back wrong tyres		N	

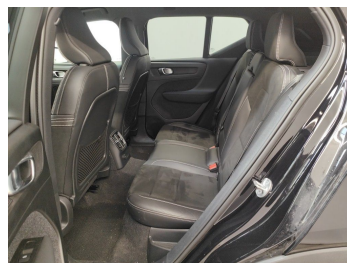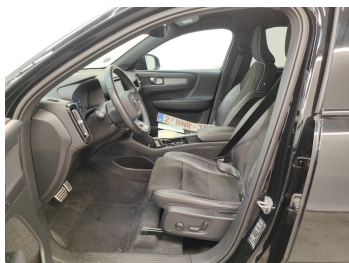



DAMAGES

Damages	Type	Acceptable
13	Bumper Front // Painting	Y
18	Bumper Front / Spoiler / Replace	N
35	Front Bonnet // Polish	Y
60	Wing Front Left // Smart Repair Small	Y
86	Door Front Left // Polish	Y
91	Rocker Panel Left // Smart Repair Medium	Y
103	Door Rear Left // Painting	Y
113	Wing Rear Left // Painting	Y
117	Wing Rear Left / Trim / Replace	Y
133	Bumper Rear // Painting	N
153	Rear Bonnet // Painting	Y
156	Rear Bonnet // Polish	Y
186	Wing Rear Right // Polish	Y
193	Door Rear Right // Painting	Y
310	Wheel Two Tone Front Left // Repair	Y
320	Wheel Two Tone Rear Left // Repair	Y
340	Wheel Two Tone Front Right // Repair	N

Damage Pictures



Wing Rear Left / Trim / Replace-scratch



Rear Bonnet // Painting-scratch



Door Rear Left // Painting-scratch



Wheel Two Tone Rear Left // Repair-scratch



Rocker Panel Left // Smart Repair Medium-scratch



Bumper Front / Spoiler / Replace-scratch



Bumper Front // Painting-scratch



Wheel Two Tone Front Right // Repair-scratch



Door Rear Right // Painting-scratch



Wheel Two Tone Front Left // Repair-scratch



Wing Front Left // Smart Repair Small-dent



Bumper Rear // Painting-bad repair




Wing Rear Left // Painting-bad repair



Rear Bonnet // Polish-Chemical reaction



Door Front Left // Polish-Chemical reaction

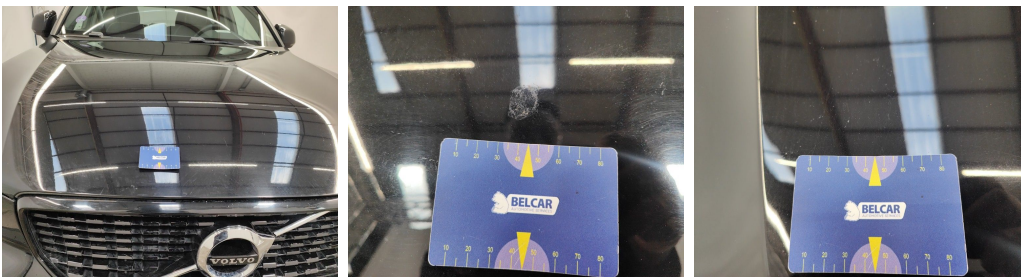

Front Bonnet // Polish-Chemical reaction



Wing Rear Right // Polish-Chemical reaction