

INSPECTION REPORT


End of contract


GENERAL INFO

File	321005
License plate	MT9214
Vehicle identification number	VF3MCYHZUMS187450
Dossier	2021055037
Make	Peugeot 5008 1.5Hdi 130 Roadtr
Mileage	147859
First registration	18/08/2021
client availability date	27/08/2026
inspectionDate	31/08/2026

CHECK POINTS

Description	Number	Present	Remark
Original license plate		N	
Registration Part 2		N	
Keys	2	Y	
Spare wheel		N	
Towbar (+keys)		Y	
Certificate of conformity		N	
Registration certificate		N	
Repair kit		Y	
RunOnFlat		N	
Charging cable		N	
Charge back wrong tyres		N	

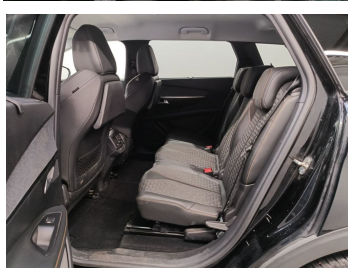

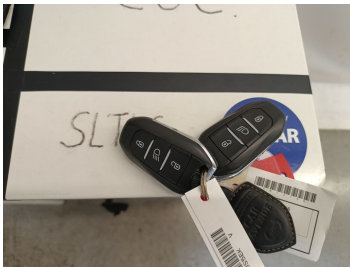

DAMAGES

Damages	Type	Acceptable
18	Bumper Front / Spoiler / Replace	N
41	Windshield // Replace	Y
81	Door Front Left // Smart Repair Medium	Y
91	Rocker Panel Left // Smart Repair Medium	N
104	Door Rear Left // Repair & Painting	Y
114	Wing Rear Left // Repair & Painting	N
124	Light / Rear left / Replace	Y
159	Rear Bonnet / Rear Window / Replace	N
160	Roof / Trim / Replace	Y
161	Roof // Smart Repair Medium	Y
165	Roof // Polish	Y
174	Light / Rear Right / Replace	Y
194	Door Rear Right // Repair & Painting	Y
201	Rocker Panel Right // Smart Repair Medium	N
213	Door Front Right // Painting	N
217	Door Front Right / Trim / Replace	Y
221	Side View Mirror Right // Plastic Repair	N
225	Side View Mirror Right // Polish	Y
310	Wheel Two Tone Front Left // Repair	Y
320	Wheel Two Tone Rear Left // Repair	Y
330	Wheel Two Tone Rear Right // Repair	Y
412	Seat Front Left / Bottom Coating / Replace	Y
422	Seat Front Right / Bottom Coating / Replace	Y
532	Trunk Compartment / Side Cover Left / Replace	Y
533	Trunk Compartment / Side Cover Right / Replace	Y
569	Dashboard / Steering Wheel / Replace	Y
594	Trunk Lid Interior Coating / Complete Panel / Replace	Y
774	Interior / Side Cover rear Seat / Replace	Y
860	Interior Cleaning // Small	Y

Damage Pictures



Bumper Front / Spoiler / Replace-scratch



Roof // Polish-scratch



Side View Mirror Right // Polish-scratch



Side View Mirror Right // Plastic Repair-scratch



Door Front Right / Trim / Replace-scratch



Door Front Right // Painting-scratch



Wheel Two Tone Rear Left // Repair-scratch



Light / Rear Right / Replace-scratch



Rear Bonnet / Rear Window / Replace-scratch



Light / Rear left / Replace-scratch



Door Front Left // Smart Repair Medium-scratch



Windshield // Replace-scratch



Trunk Compartment / Side Cover Right / Replace-scratch



Trunk Compartment / Side Cover Left / Replace-scratch



Interior / Side Cover rear Seat / Replace-scratch



Dashboard / Steering Wheel / Replace-scratch



Roof / Trim / Replace-dent



Roof // Smart Repair Medium-dent



Door Rear Left // Repair & Painting-scratch + dent




Rocker Panel Left // Smart Repair Medium-scratch + dent



Wing Rear Left // Repair & Painting-scratch + dent



Rocker Panel Right // Smart Repair Medium-scratch + dent

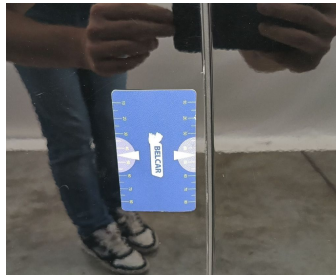

Door Rear Right // Repair & Painting-scratch + dent



Wheel Two Tone Rear Right // Repair-Chemical reaction



Wheel Two Tone Front Left // Repair-Chemical reaction



Interior Cleaning // Small-dirty



Seat Front Left / Bottom Coating / Replace-worn



Seat Front Right / Bottom Coating / Replace-worn



Trunk Lid Interior Coating / Complete Panel / Replace-N
comf / out of order