

INSPECTION REPORT


End of contract

GENERAL INFO

File	311683
License plate	HX4250
Vehicle identification number	ZACPJFEW1MPR72134
Dossier	2021229002
Make	Jeep Com.1.3PHEV 180 S eAWD A
Mileage	127335
First registration	15/12/2021
client availability date	28/04/2026
inspectionDate	30/04/2026

CHECK POINTS

Description	Number	Present	Remark
Original license plate		N	
Registration Part 2		N	
Keys	2	Y	
Spare wheel		N	
Towbar (+keys)		N	
Certificate of conformity		N	
Registration certificate		N	
Repair kit		Y	
RunOnFlat		N	
Charging cable		Y	
Charge back wrong tyres		N	

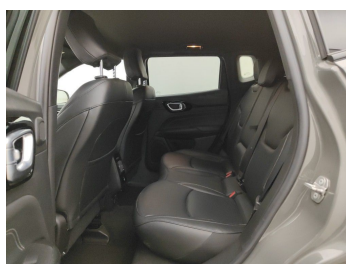



DAMAGES

Damages	Type	Acceptable
16	Bumper Front // Polish	Y
31	Front Bonnet // Smart Repair Small	Y
38	Front Bonnet / Insulation / Replace	N
95	Rocker Panel Left // Polish	Y
100	Door Rear Left // Smart Repair Small	Y
116	Wing Rear Left // Polish	Y
124	Light / Rear left / Replace	Y
133	Bumper Rear // Painting	N
153	Rear Bonnet // Painting	N
157	Rear Bonnet / Trim / Replace	N
159	Rear Bonnet / Rear Window / Replace	Y
174	Light / Rear Right / Replace	N
186	Wing Rear Right // Polish	Y
187	Wing Rear Right / Trim / Replace	Y
194	Door Rear Right // Repair & Painting	Y
202	Rocker Panel Right // Painting	Y
214	Door Front Right // Repair & Painting	N
257	Front / Towing Cover / Replace	N
281	Bumper Rear / Trim Left / Replace	N
283	Bumper Rear / Trim Right / Replace	N
311	Wheel Alloy Front Left // Repair	N
321	Wheel Alloy Rear Left // Repair	N
331	Wheel Alloy Rear Right // Repair	N
341	Wheel Alloy Front Right // Repair	N
565	Dashboard / Storage Tray / Replace	Y
883	Key Price Range 2 //	Y

Damage Pictures



Light / Rear left / Replace-scratch



Bumper Rear // Painting-scratch



Light / Rear Right / Replace-scratch



Rear Bonnet / Rear Window / Replace-scratch



Wing Rear Right / Trim / Replace-scratch



Wheel Alloy Rear Right // Repair-scratch



Wing Rear Right // Polish-scratch



Rocker Panel Right // Painting-scratch



Wheel Alloy Front Right // Repair-scratch



Bumper Front // Polish-scratch



Door Rear Left // Smart Repair Small-scratch



Rocker Panel Left // Polish-scratch



Wheel Alloy Rear Left // Repair-scratch



Wing Rear Left // Polish-scratch




Dashboard / Storage Tray / Replace-scratch




Wheel Alloy Front Left // Repair-scratch



Front Bonnet // Smart Repair Small-dent

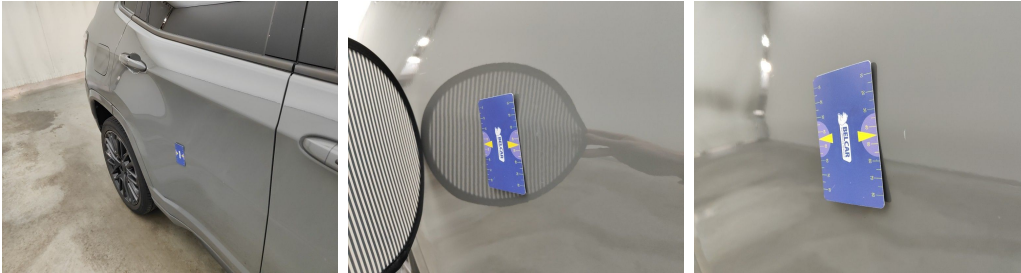

Door Rear Right // Repair & Painting-scratch + dent

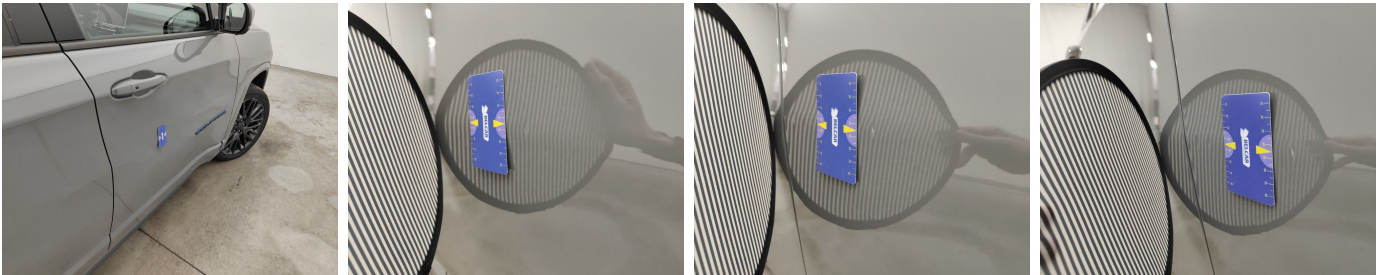


Door Front Right // Repair & Painting-scratch + dent



Rear Bonnet / Trim / Replace-bad repair



Bumper Rear / Trim Left / Replace-bad repair

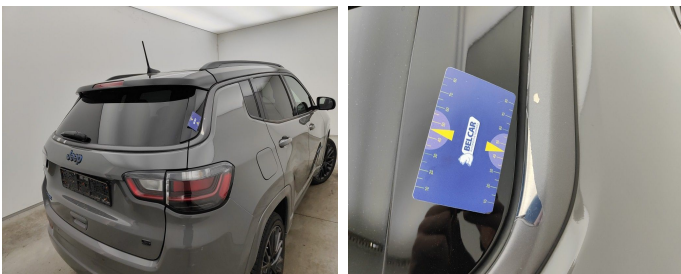

Bumper Rear / Trim Right / Replace-bad repair



Rear Bonnet // Painting-bad repair



Front / Towing Cover / Replace-missing



Front Bonnet / Insulation / Replace-tear



Key Price Range 2 //-worn