

INSPECTION REPORT

End of contract

GENERAL INFO

File	318032
License plate	2AWW713
Vehicle identification number	VF3V1ZKXZMZ074784
Dossier	2021127114
Make	Peugeot Expert EV 75kWh Stan.P
Mileage	97127
First registration	20/08/2021
client availability date	22/07/2026
inspectionDate	11/08/2026

CHECK POINTS

Description	Number	Present	Remark
Original license plate		Y	
Registration Part 2		N	
Keys	2	Y	
Spare wheel		Y	
Towbar (+keys)		N	
Certificate of conformity		Y	
Registration certificate		Y	
Repair kit		N	
RunOnFlat		N	
Charging cable		N	
Charge back wrong tyres		Y	





DAMAGES

Damages	Type	Acceptable
194	Door Rear Right // Repair & Painting	N
197	Door Rear Right / Trim / Replace	N
203	Rocker Panel Right // Repair & Painting	N
214	Door Front Right // Repair & Painting	N
217	Door Front Right / Trim / Replace	N
83	Door Front Left // Painting	N
114	Wing Rear Left // Repair & Painting	N
891	Lettering Removal 15min	N
19	Bumper Front / Lower Cover Not Painted / Replace	Y
38	Front Bonnet / Insulation / Replace	N
64	Wing Front Left // Repair & Painting	Y
161	Roof // Smart Repair Medium	N
163	Roof // Repair & Painting	Y
174	Light / Rear Right / Replace	N
184	Wing Rear Right // Repair & Painting	N
227	Side View Mirror Right / Shell / Replace Not Painted	Y
234	Wing Front right // Repair & Painting	N
294	Rear Loading Door Left // Repair & Painting	Y
304	Rear Loading Door Right // Repair & Painting	Y
412	Seat Front Left / Bottom Coating / Replace	Y
532	Trunk Compartment / Side Cover Left / Replace	Y
533	Trunk Compartment / Side Cover Right / Replace	Y
540	Interior // Repair 1	N
541	Interior // Repair 2	N
561	Dashboard // Repair	Y
569	Dashboard / Steering Wheel / Replace	Y
592	Trunk Lid Interior Coating / MDF Rear Left / Replace	N
593	Trunk Lid Interior Coating / MDF Rear Right / Replace	N
595	Trunk Lid Interior Coating / MDF Side Door Left / Replace	N
599	Trunk Lid Interior Coating / MDF Side Door Right / Replace	N

684	Charger Cable //	N
860	Interior Cleaning // Small	N

Damage Pictures



Light / Rear Right / Replace-scratch



Side View Mirror Right / Shell / Replace Not Painted-scratch



Bumper Front / Lower Cover Not Painted / Replace-scratch



Roof // Smart Repair Medium-scratch + dent



Wing Front Left // Repair & Painting-scratch + dent




Dashboard // Repair-scratch



Roof // Repair & Painting-scratch + dent



Rear Loading Door Left // Repair & Painting-scratch + dent

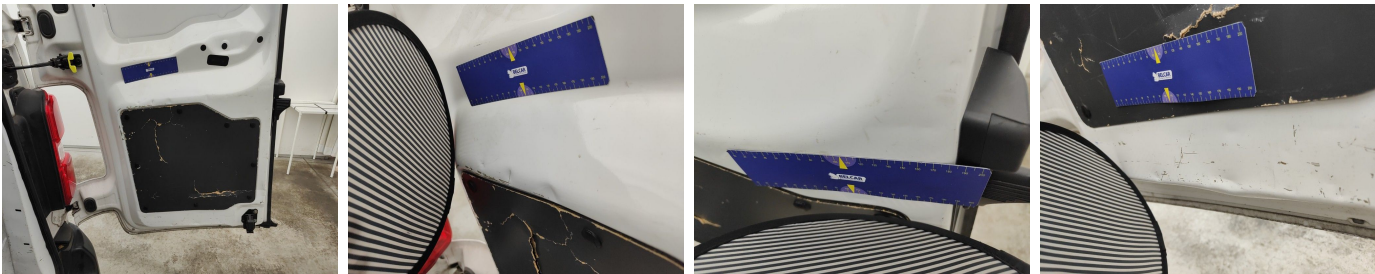



Rear Loading Door Right // Repair & Painting-scratch + dent



Trunk Compartment / Side Cover Left / Replace-scratch + dent




Trunk Compartment / Side Cover Right / Replace-scratch + dent



Interior // Repair 2-cracked




Interior // Repair 1-cracked

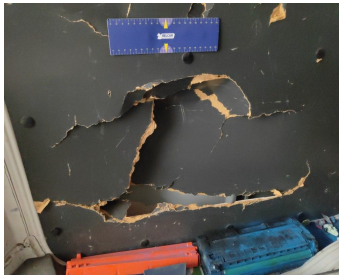


Trunk Lid Interior Coating / MDF Side Door Left /
Replace-cracked



Trunk Lid Interior Coating / MDF Side Door Right /
Replace-cracked

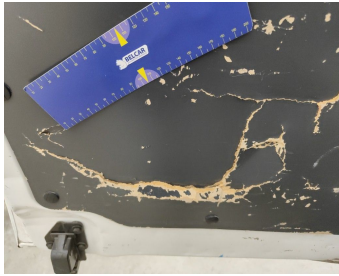


Trunk Lid Interior Coating / MDF Rear Left / Replace-
cracked

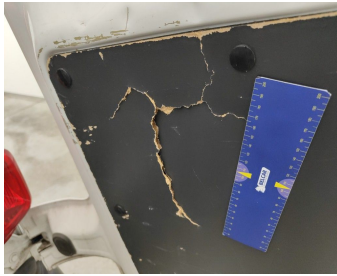

Trunk Lid Interior Coating / MDF Rear Right / Replace-
cracked



Front Bonnet / Insulation / Replace-tear

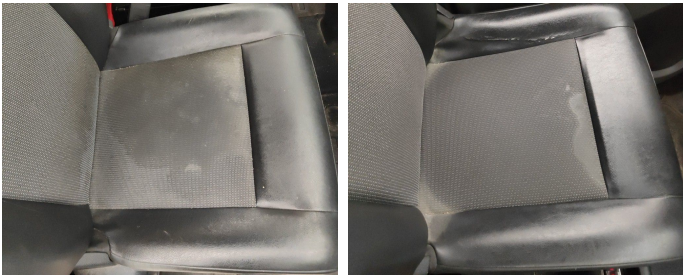

Interior Cleaning // Small-stain



Dashboard / Steering Wheel / Replace-worn



Seat Front Left / Bottom Coating / Replace-worn



Wing Rear Right // Repair & Painting-scratch + dent



Wing Front right // Repair & Painting-scratch + dent



Door Front Right / Trim / Replace-scratch



Rocker Panel Right // Repair & Painting-scratch + dent



Door Rear Right // Repair & Painting-scratch + dent



Door Front Right // Repair & Painting-scratch + dent



Door Rear Right / Trim / Replace-missing



Lettering Removal 15min-



Door Front Left // Painting-scratch



Wing Rear Left // Repair & Painting-dent