

INSPECTION REPORT

End of contract

GENERAL INFO

File	310834
License plate	2BSG706
Vehicle identification number	ZFA2250006W19681
Dossier	2021337131
Make	Fiat Fiorino C.1.3Mjet 80 E6D
Mileage	106973
First registration	07/03/2022
client availability date	16/04/2026
inspectionDate	27/04/2026

CHECK POINTS

Description	Number	Present	Remark
Original license plate		Y	
Registration Part 2		N	
Keys	2	Y	
Spare wheel		Y	
Towbar (+keys)		N	
Certificate of conformity		Y	
Registration certificate		Y	
Repair kit		N	
RunOnFlat		N	
Charging cable		N	
Charge back wrong tyres		N	





DAMAGES

Damages	Type	Acceptable
73	Side View Mirror Left // Replace Not Painted	Y
77	Side View Mirror Left / Shell / Replace Not Painted	Y
183	Wing Rear Right // Painting	N
193	Door Rear Right // Painting	N
124	Light / Rear left / Replace	N
138	Bumper Rear / Lower Cover Not Painted / Replace	N
258	Towing Cover Rear // Replace	N
294	Rear Loading Door Left // Repair & Painting	N
304	Rear Loading Door Right // Repair & Painting	N
19	Bumper Front / Lower Cover Not Painted / Replace	Y
33	Front Bonnet // Repair & Painting	N
80	Door Front Left // Smart Repair Small	Y
116	Wing Rear Left // Polish	Y
163	Roof // Repair & Painting	Y
233	Wing Front right // Painting	Y
257	Front / Towing Cover / Replace	Y
314	Wheel Front Left / Wheel Cover / Replace	Y
334	Wheel Rear Right / Wheel Cover / Replace	Y
344	Wheel Front Right / Wheel Cover / Replace	N
412	Seat Front Left / Bottom Coating / Replace	N
413	Seat Front Left / Rear Coating / Replace	N
569	Dashboard / Steering Wheel / Replace	Y
592	Trunk Lid Interior Coating / MDF Rear Left / Replace	N

Damage Pictures



Wheel Front Left / Wheel Cover / Replace-scratch



Trunk Lid Interior Coating / MDF Rear Left / Replace-cracked



Wheel Front Right / Wheel Cover / Replace-cracked



Seat Front Left / Rear Coating / Replace-Incinerated



Seat Front Left / Bottom Coating / Replace-Incinerated



Front / Towing Cover / Replace-bad position



Door Front Left // Smart Repair Small-scratch



Wing Rear Left // Polish-scratch



Dashboard / Steering Wheel / Replace-scratch




Wing Front right // Painting-scratch



Bumper Front / Lower Cover Not Painted / Replace-scratch



Front Bonnet // Repair & Painting-dent

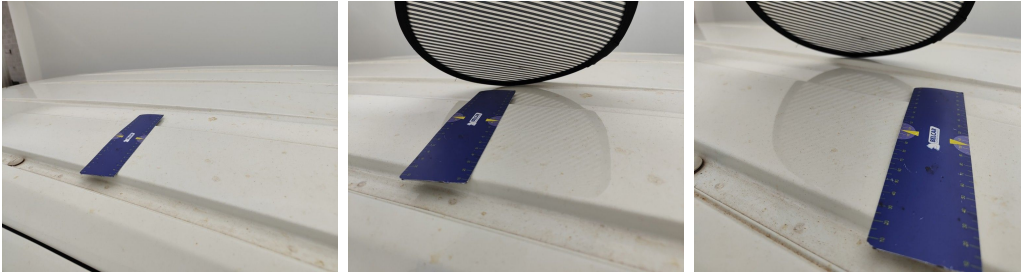

Roof // Repair & Painting-dent



Wheel Rear Right / Wheel Cover / Replace-scratch




Side View Mirror Left // Replace Not Painted-scratch



Side View Mirror Left / Shell / Replace Not Painted-scratch




Rear Loading Door Left // Repair & Painting-scratch + dent

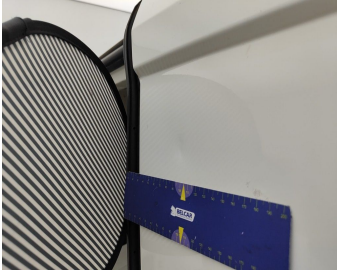

Rear Loading Door Right // Repair & Painting-scratch + dent



Door Rear Right // Painting-scratch

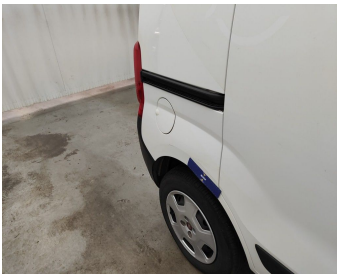

Wing Rear Right // Painting-scratch



Towing Cover Rear // Replace-scratch + dent



Light / Rear left / Replace-cracked



Bumper Rear / Lower Cover Not Painted / Replace-hole