

INSPECTION REPORT

End of contract

GENERAL INFO

File	318446
License plate	1YMT187
Vehicle identification number	W0VECYHZJLJ855938
Dossier	2020 178 056
Make	Opel Combo L 1.5TD 96kW L1H1 E
Mileage	93029
First registration	19/10/2020
client availability date	23/07/2026
inspectionDate	17/08/2026

CHECK POINTS

Description	Number	Present	Remark
Original license plate		Y	
Registration Part 2		N	
Keys	1	Y	
Spare wheel		Y	
Towbar (+keys)		N	
Certificate of conformity		Y	
Registration certificate		Y	
Repair kit		N	
RunOnFlat		N	
Charging cable		N	
Charge back wrong tyres		Y	





DAMAGES

Damages	Type	Acceptable
14	Bumper Front // Repair & Painting	N
64	Wing Front Left // Repair & Painting	N
344	Wheel Front Right / Wheel Cover / Replace	N
346	Tyre Front Right // Replace	N
38	Front Bonnet / Insulation / Replace	N
41	Windshield // Replace	Y
80	Door Front Left // Smart Repair Small	N
100	Door Rear Left // Smart Repair Small	Y
136	Bumper Rear // Polish	Y
156	Rear Bonnet // Polish	Y
159	Rear Bonnet / Rear Window / Replace	Y
186	Wing Rear Right // Polish	Y
194	Door Rear Right // Repair & Painting	Y
197	Door Rear Right / Trim / Replace	Y
201	Rocker Panel Right // Smart Repair Medium	Y
210	Door Front Right // Smart Repair Small	Y
217	Door Front Right / Trim / Replace	Y
225	Side View Mirror Right // Polish	Y
236	Wing Front right // Polish	Y
314	Wheel Front Left / Wheel Cover / Replace	N
334	Wheel Rear Right / Wheel Cover / Replace	N
336	Tyre Rear Right // Replace	Y
594	Trunk Lid Interior Coating / Complete Panel / Replace	Y
860	Interior Cleaning // Small	N
883	Key Price Range 2 //	N

Damage Pictures



Interior Cleaning // Small-stain



Tyre Rear Right // Replace-worn



Door Rear Right // Repair & Painting-bad position



Wing Front right // Polish-scratch



Trunk Lid Interior Coating / Complete Panel / Replace-scratch



Rocker Panel Right // Smart Repair Medium-dent



Door Rear Left // Smart Repair Small-dent



Door Front Right // Smart Repair Small-dent



Door Front Left // Smart Repair Small-scratch + dent



Wheel Front Left / Wheel Cover / Replace-missing



Front Bonnet / Insulation / Replace-tear



Windshield // Replace-scratch



Rear Bonnet // Polish-scratch



Bumper Rear // Polish-scratch



Rear Bonnet / Rear Window / Replace-scratch



Wing Rear Right // Polish-scratch



Wheel Rear Right / Wheel Cover / Replace-scratch




Door Rear Right / Trim / Replace-scratch




Door Front Right / Trim / Replace-scratch



Side View Mirror Right // Polish-scratch

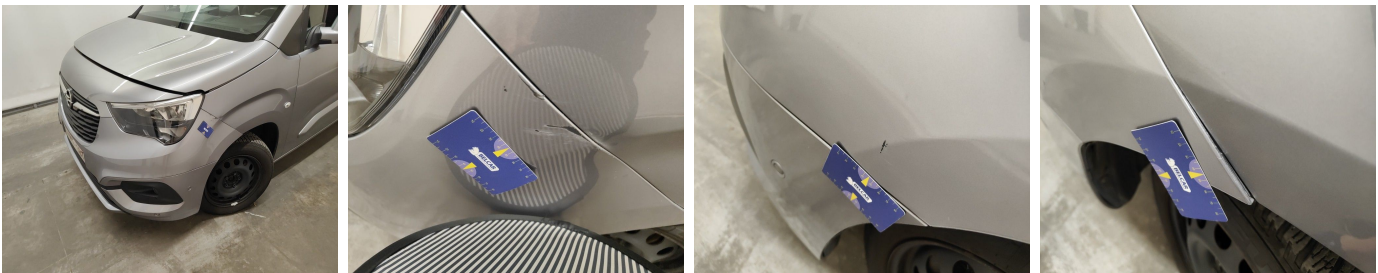

Bumper Front // Repair & Painting-scratch + dent

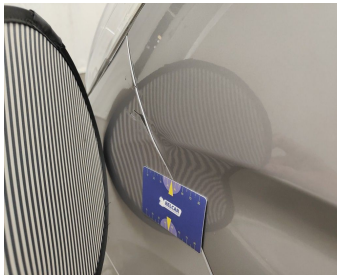

Wing Front Left // Repair & Painting-scratch + dent



Wheel Front Right / Wheel Cover / Replace-scratch



Tyre Front Right // Replace-tear