

INSPECTION REPORT

End of contract

GENERAL INFO

File	308109
License plate	2BFD532
Vehicle identification number	KMHC851CGNU266848
Dossier	2021 298 132
Make	Hyundai Ioniq 1.6Di Hybride F
Mileage	208373
First registration	29/10/2021
client availability date	17/03/2026
inspectionDate	08/04/2026

CHECK POINTS

Description	Number	Present	Remark
Original license plate		Y	
Registration Part 2		N	
Keys	2	Y	
Spare wheel		N	
Towbar (+keys)		N	
Certificate of conformity		Y	
Registration certificate		Y	
Repair kit		Y	
RunOnFlat		N	
Charging cable		N	
Charge back wrong tyres		N	





DAMAGES


Damages	Type	Acceptable
14	Bumper Front // Repair & Painting	N
214	Door Front Right // Repair & Painting	N
234	Wing Front right // Repair & Painting	N
134	Bumper Rear // Repair & Painting	N
183	Wing Rear Right // Painting	N
191	Door Rear Right // Smart Repair Medium	N
193	Door Rear Right // Painting	N
18	Bumper Front / Spoiler / Replace	N
41	Windshield // Replace	N
80	Door Front Left // Smart Repair Small	Y
81	Door Front Left // Smart Repair Medium	Y
87	Door Front Left / Trim / Replace	Y
91	Rocker Panel Left // Smart Repair Medium	N
93	Rocker Panel Left // Repair & Painting	N
104	Door Rear Left // Repair & Painting	Y
113	Wing Rear Left // Painting	Y
124	Light / Rear left / Replace	Y
156	Rear Bonnet // Polish	Y
161	Roof // Smart Repair Medium	Y
163	Roof // Repair & Painting	Y
169	Rear Bonnet / Spoiler / Replace & Painting	N
174	Light / Rear Right / Replace	N
201	Rocker Panel Right // Smart Repair Medium	N
201	Rocker Panel Right // Smart Repair Medium	N
210	Door Front Right // Smart Repair Small	N
217	Door Front Right / Trim / Replace	Y
311	Wheel Alloy Front Left // Repair	N
314	Wheel Front Left / Wheel Cover / Replace	Y
321	Wheel Alloy Rear Left // Repair	N
324	Wheel Rear Left / Wheel Cover / Replace	Y

331	Wheel Alloy Rear Right // Repair	N
334	Wheel Rear Right / Wheel Cover / Replace	Y
341	Wheel Alloy Front Right // Repair	N
344	Wheel Front Right / Wheel Cover / Replace	N
411	Seat Front Left // Repair	Y
413	Seat Front Left / Rear Coating / Replace	N
421	Seat Front Right // Repair	Y
532	Trunk Compartment / Side Cover Left / Replace	Y
533	Trunk Compartment / Side Cover Right / Replace	Y
534	Trunk Compartment / Carpet / Replace	Y
540	Interior // Repair 1	N
540	Interior // Repair 1	N
541	Interior // Repair 2	N
554	Central Console // Replace Completely	Y
564	Dashboard // Replace Completely	Y
565	Dashboard / Storage Tray / Replace	Y
568	Dashboard / Ventilation Outlet / Replace	N
569	Dashboard / Steering Wheel / Replace	Y
594	Trunk Lid Interior Coating / Complete Panel / Replace	Y
624	Front Right Door Interior Coating // Replace Completely	Y
634	Rear Left Door Interior Coating // Replace Completely	Y
644	Rear Right Door Interior Coating // Replace Completely	Y
647	Rear Right Door Interior Coating / Grid Loudspeaker / Replace	Y
860	Interior Cleaning // Small	N

Damage Pictures




Rear Bonnet // Polish-scratch

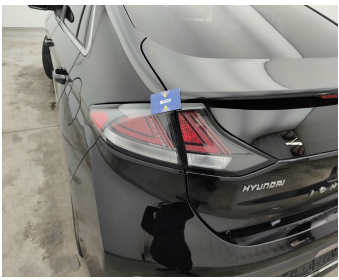

Light / Rear left / Replace-scratch



Roof // Smart Repair Medium-scratch

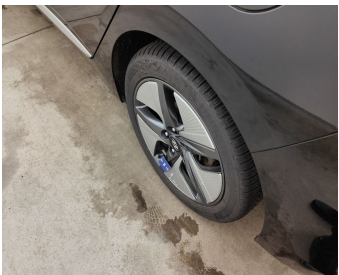


Wheel Rear Left / Wheel Cover / Replace-scratch



Wheel Alloy Rear Left // Repair-scratch



Wing Rear Left // Painting-scratch

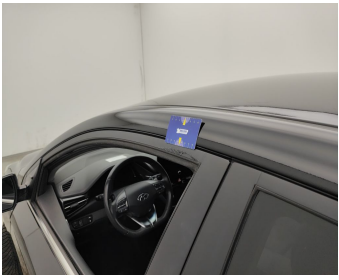

Door Front Left / Trim / Replace-scratch




Door Front Left // Smart Repair Medium-scratch



Door Front Right / Trim / Replace-scratch



Door Front Right // Smart Repair Small-scratch

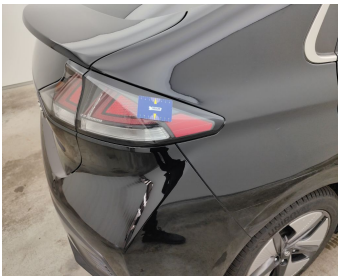

Light / Rear Right / Replace-scratch



Wheel Front Left / Wheel Cover / Replace-scratch



Wheel Alloy Front Left // Repair-scratch



Wheel Front Right / Wheel Cover / Replace-scratch



Wheel Alloy Front Right // Repair-scratch




Bumper Front / Spoiler / Replace-scratch



Door Front Left // Smart Repair Small-scratch




Seat Front Left // Repair-scratch

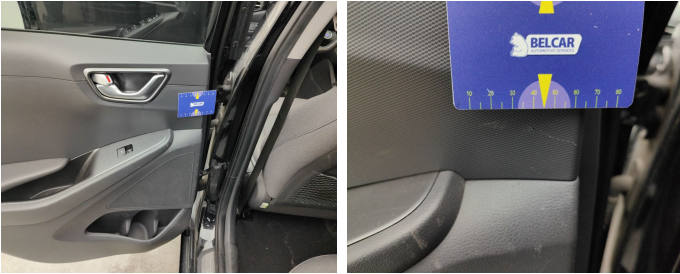


Rear Left Door Interior Coating // Replace Completely-scratch



Trunk Compartment / Side Cover Left / Replace-scratch

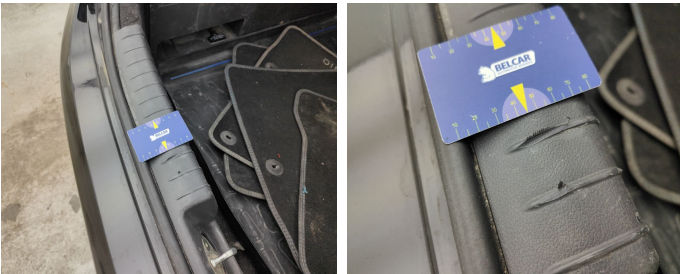

Trunk Compartment / Carpet / Replace-scratch

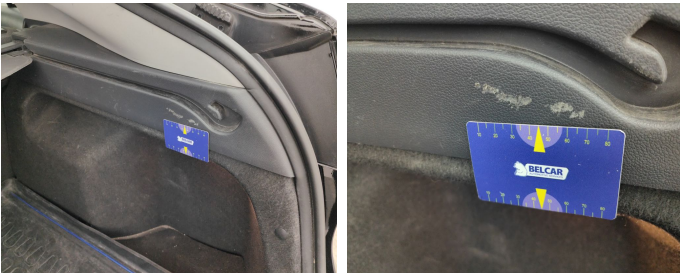

Trunk Compartment / Side Cover Right / Replace-scratch




Trunk Lid Interior Coating / Complete Panel / Replace-scratch



Central Console // Replace Completely-scratch



Seat Front Right // Repair-scratch

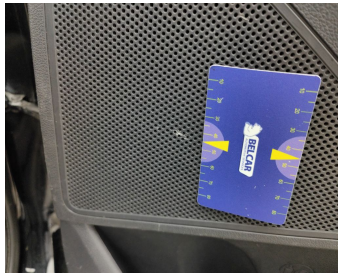

Rear Right Door Interior Coating / Grid Loudspeaker / Replace-scratch



Rear Right Door Interior Coating // Replace Completely-scratch




Dashboard // Replace Completely-scratch



Dashboard / Storage Tray / Replace-scratch



Front Right Door Interior Coating // Replace Completely-scratch

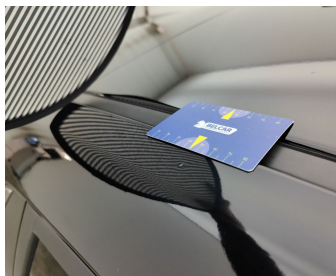

Roof // Repair & Painting-dent



Wheel Rear Right / Wheel Cover / Replace-scratch



Wheel Alloy Rear Right // Repair-scratch




Rocker Panel Right // Smart Repair Medium-scratch




Rocker Panel Right // Smart Repair Medium-scratch + dent




Rocker Panel Left // Repair & Painting-scratch + dent

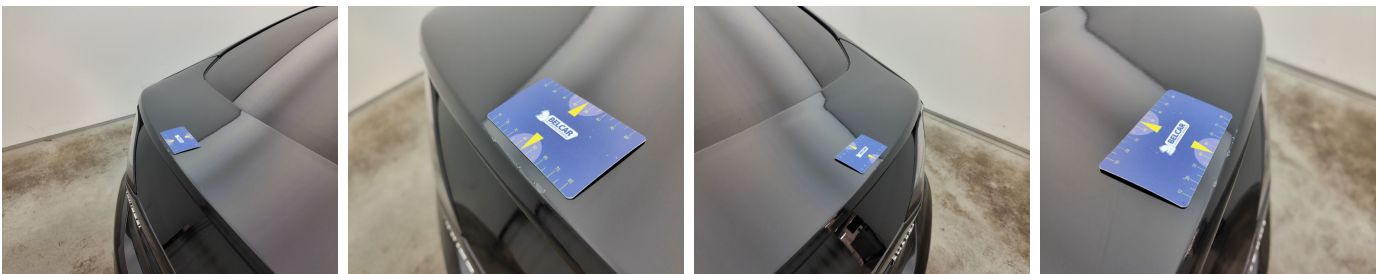

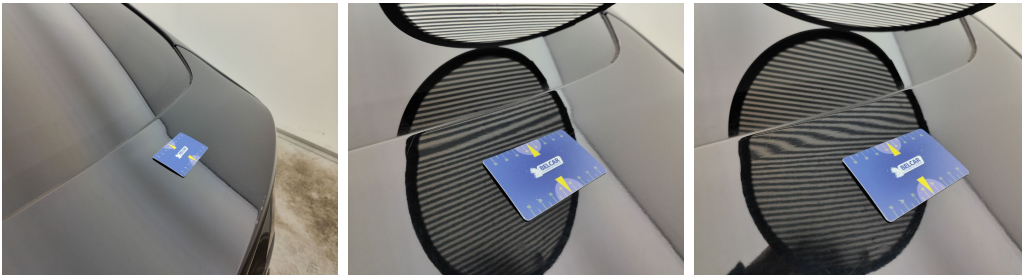

Rear Bonnet / Spoiler / Replace & Painting-scratch + dent

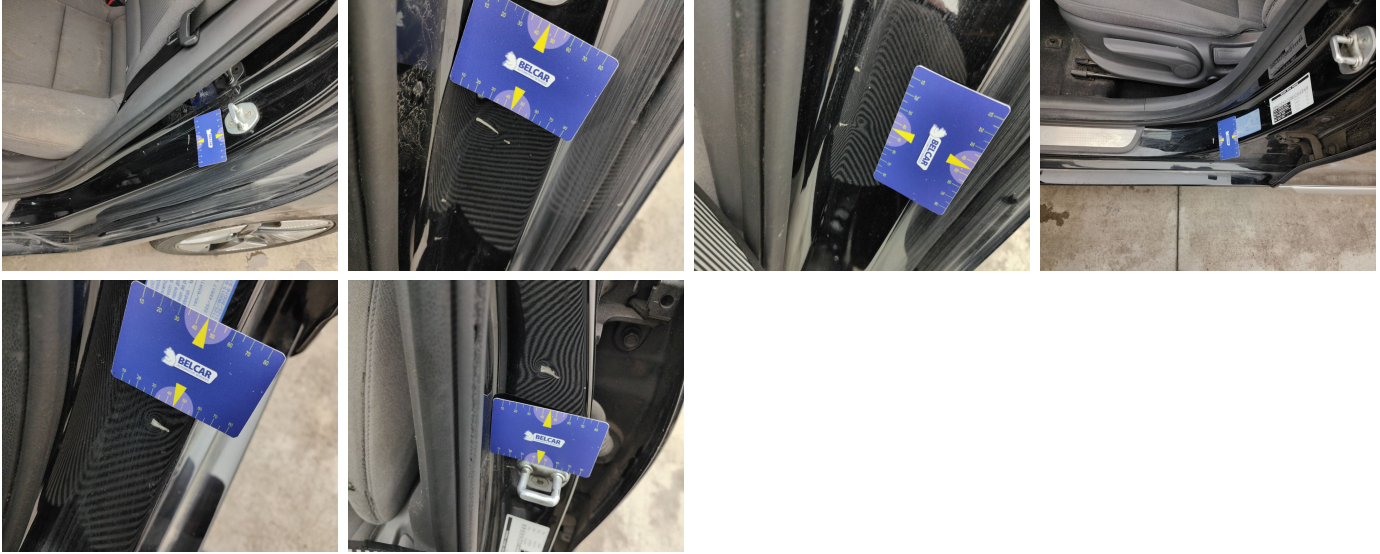

Rocker Panel Left // Smart Repair Medium-scratch + dent



Door Rear Left // Repair & Painting-scratch + dent



Dashboard / Ventilation Outlet / Replace-cracked



Windshield // Replace-cracked



Interior // Repair 2-missing



Interior // Repair 1-tear



Interior // Repair 1-hole



Seat Front Left / Rear Coating / Replace-tear




Interior Cleaning // Small-stain



Dashboard / Steering Wheel / Replace-worn




Bumper Front // Repair & Painting-scratch + dent

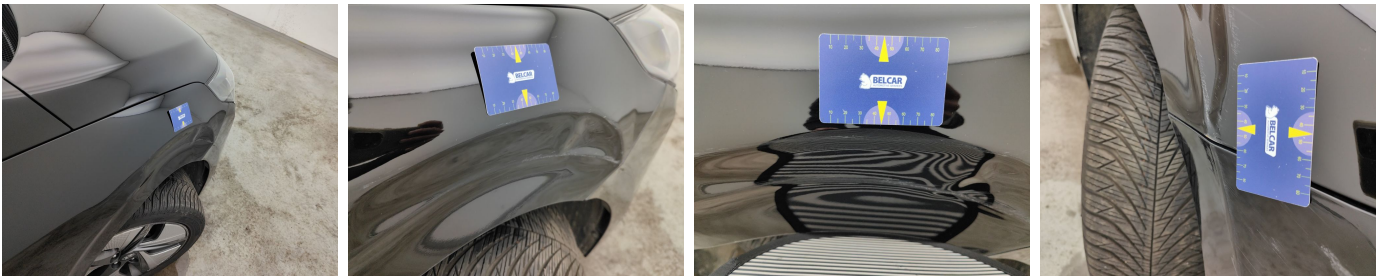

Wing Front right // Repair & Painting-scratch + dent




Door Front Right // Repair & Painting-scratch + dent

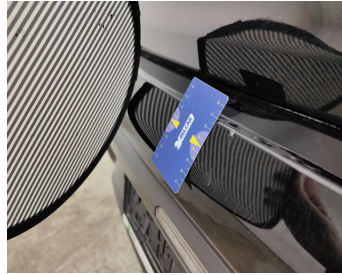

Bumper Rear // Repair & Painting-scratch + dent



Door Rear Right // Smart Repair Medium-scratch

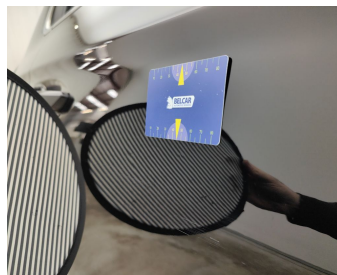

Door Rear Right // Painting-scratch



Wing Rear Right // Painting-scratch