

INSPECTION REPORT

End of contract

GENERAL INFO

File	311443
License plate	2BSL304
Vehicle identification number	W1V44760513964270
Dossier	2022056021
Make	Mercedes Vito 114CDI L3 3050 A
Mileage	205746
First registration	08/03/2022
client availability date	24/04/2026
inspectionDate	05/05/2026

CHECK POINTS

Description	Number	Present	Remark
Original license plate		Y	
Registration Part 2		N	
Keys	3	Y	
Spare wheel		Y	
Towbar (+keys)		N	
Certificate of conformity		Y	
Registration certificate		Y	
Repair kit		N	
RunOnFlat		N	
Charging cable		N	
Charge back wrong tyres		Y	






DAMAGES

Damages	Type	Acceptable
19	Bumper Front / Lower Cover Not Painted / Replace	Y
35	Front Bonnet // Polish	Y
64	Wing Front Left // Repair & Painting	N
84	Door Front Left // Repair & Painting	N
91	Rocker Panel Left // Smart Repair Medium	Y
110	Wing Rear Left // Smart Repair Small	Y
186	Wing Rear Right // Polish	Y
190	Door Rear Right // Smart Repair Small	Y
201	Rocker Panel Right // Smart Repair Medium	Y
210	Door Front Right // Smart Repair Small	Y
236	Wing Front right // Polish	Y
293	Rear Loading Door Left // Painting	N
303	Rear Loading Door Right // Painting	N
314	Wheel Front Left / Wheel Cover / Replace	Y
324	Wheel Rear Left / Wheel Cover / Replace	Y
334	Wheel Rear Right / Wheel Cover / Replace	N
344	Wheel Front Right / Wheel Cover / Replace	Y
624	Front Right Door Interior Coating // Replace Completely	Y



Damage Pictures




Wheel Front Right / Wheel Cover / Replace-scratch

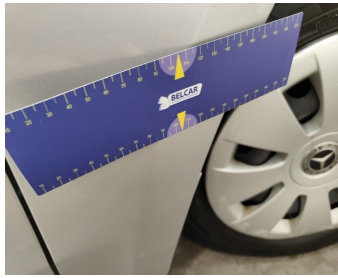


Wing Front right // Polish-scratch

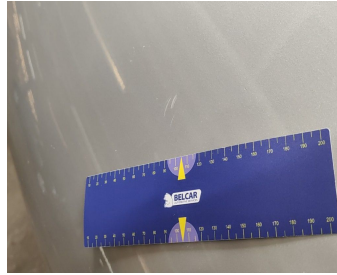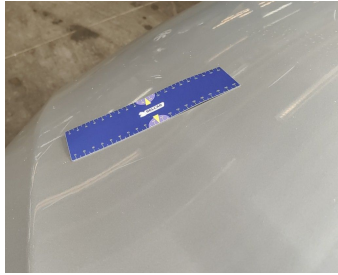

Front Bonnet // Polish-scratch

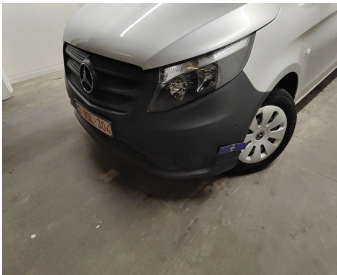

Bumper Front / Lower Cover Not Painted / Replace-scratch

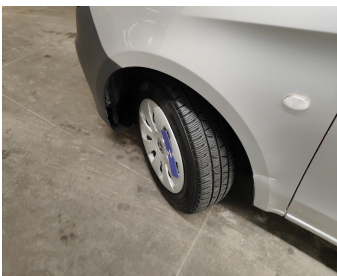

Wheel Front Left / Wheel Cover / Replace-scratch



Rear Loading Door Right // Painting-scratch



Wing Rear Right // Polish-scratch



Wheel Rear Left / Wheel Cover / Replace-scratch



Front Right Door Interior Coating // Replace Completely-scratch



Door Front Right // Smart Repair Small-dent



Door Rear Right // Smart Repair Small-dent



Wing Rear Left // Smart Repair Small-dent



Rocker Panel Right // Smart Repair Medium-scratch + dent



Wing Front Left // Repair & Painting-scratch + dent



Rocker Panel Left // Smart Repair Medium-scratch + dent



Door Front Left // Repair & Painting-scratch + dent



Rear Loading Door Left // Painting-bad repair



Wheel Rear Right / Wheel Cover / Replace-cracked