

INSPECTION REPORT

End of contract

GENERAL INFO

File	316293
License plate	2AHY146
Vehicle identification number	TMBJF7NU4M5038248
Dossier	2021012010
Make	Skoda Karoq 2.0TDi 85kW Clever
Mileage	161080
First registration	09/04/2021
client availability date	01/07/2026
inspectionDate	06/08/2026

CHECK POINTS

Description	Number	Present	Remark
Original license plate		Y	
Registration Part 2		N	
Keys	2	Y	
Spare wheel		N	
Towbar (+keys)		Y	
Certificate of conformity		Y	
Registration certificate		Y	
Repair kit		Y	
RunOnFlat		N	
Charging cable		N	
Charge back wrong tyres		N	





DAMAGES

Damages	Type	Acceptable
87	Door Front Left / Trim / Replace	N
107	Door Rear Left / Trim / Replace	N
19	Bumper Front / Lower Cover Not Painted / Replace	Y
35	Front Bonnet // Polish	Y
38	Front Bonnet / Insulation / Replace	Y
66	Wing Front Left // Polish	Y
80	Door Front Left // Smart Repair Small	N
91	Rocker Panel Left // Smart Repair Medium	N
103	Door Rear Left // Painting	Y
113	Wing Rear Left // Painting	N
138	Bumper Rear / Lower Cover Not Painted / Replace	Y
139	Bumper Rear / Spoiler / Replace	Y
153	Rear Bonnet // Painting	Y
165	Roof // Polish	Y
174	Light / Rear Right / Replace	N
183	Wing Rear Right // Painting	Y
190	Door Rear Right // Smart Repair Small	Y
201	Rocker Panel Right // Smart Repair Medium	N
216	Door Front Right // Polish	Y
236	Wing Front right // Polish	Y
311	Wheel Alloy Front Left // Repair	Y
321	Wheel Alloy Rear Left // Repair	Y
548	Interior / Side Cover / Replace	N
556	Central Console / Cover Armrest / Replace Cover Armrest	N
569	Dashboard / Steering Wheel / Replace	Y
593	Trunk Lid Interior Coating / MDF Rear Right / Replace	Y
594	Trunk Lid Interior Coating / Complete Panel / Replace	Y
611	Front Left Door Interior Coating // Repair	N
621	Front Right Door Interior Coating // Repair	N
631	Rear Left Door Interior Coating // Repair	N

641	Rear Right Door Interior Coating // Repair	N
840	Interior Cleaning // Large	N

Damage Pictures



Rear Left Door Interior Coating // Repair-scratch



Rocker Panel Left // Smart Repair Medium-scratch + dent





Rocker Panel Right // Smart Repair Medium-scratch + dent



Light / Rear Right / Replace-cracked



Central Console / Cover Armrest / Replace Cover
Armrest-cracked

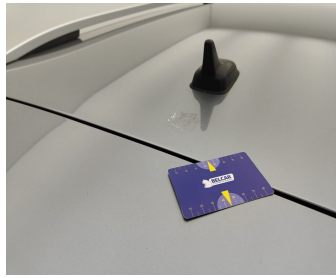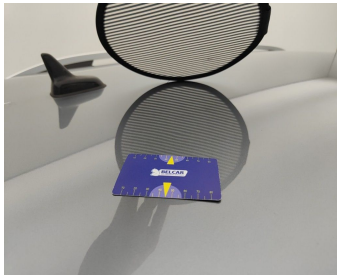


Roof // Polish-Chemical reaction



Interior Cleaning // Large-stain



Dashboard / Steering Wheel / Replace-worn

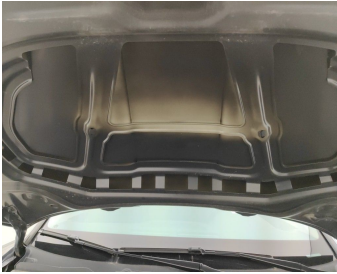

Front Bonnet / Insulation / Replace-bad position



Door Front Right // Polish-scratch



Wing Front right // Polish-scratch



Bumper Front / Lower Cover Not Painted / Replace-scratch



Wheel Alloy Rear Left // Repair-scratch



Front Left Door Interior Coating // Repair-scratch



Wheel Alloy Front Left // Repair-scratch




Wing Front Left // Polish-scratch



Door Front Left // Smart Repair Small-scratch



Door Rear Left // Painting-scratch

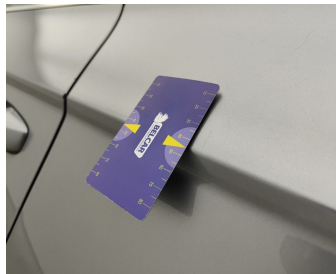

Wing Rear Left // Painting-scratch



Bumper Rear / Spoiler / Replace-scratch



Bumper Rear / Lower Cover Not Painted / Replace-scratch




Rear Bonnet // Painting-scratch



Door Rear Right // Smart Repair Small-scratch





Wing Rear Right // Painting-scratch

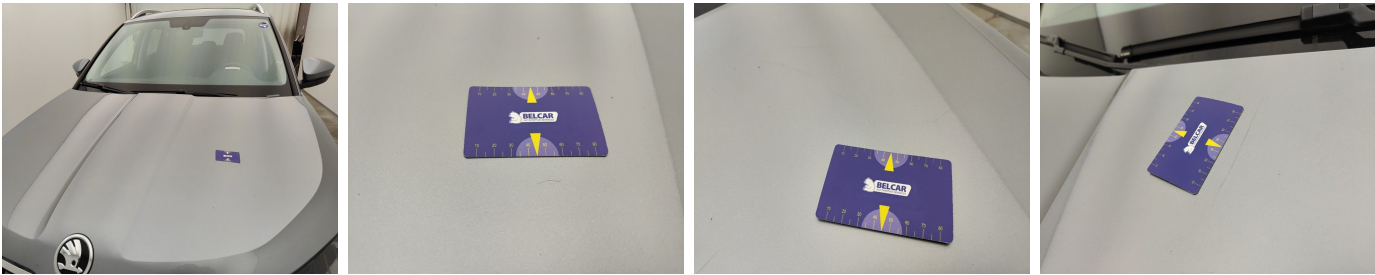

Front Bonnet // Polish-scratch



Front Right Door Interior Coating // Repair-scratch

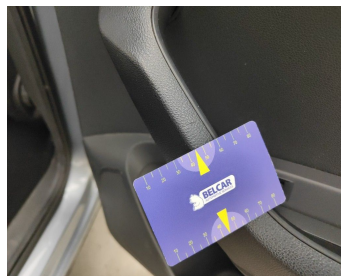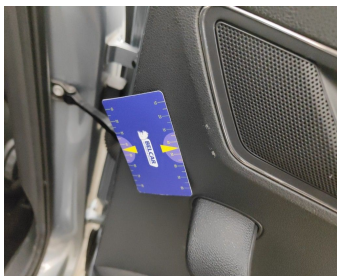


Rear Right Door Interior Coating // Repair-scratch



Trunk Lid Interior Coating / MDF Rear Right / Replace-scratch



Trunk Lid Interior Coating / Complete Panel / Replace-scratch

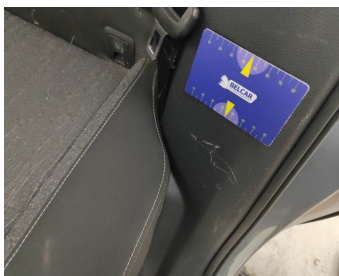

Interior / Side Cover / Replace-scratch



Door Front Left / Trim / Replace-scratch



Door Rear Left / Trim / Replace-scratch